




Front Fork

RXF38 m.3/m.2/m.1

Workshop Manual - 50 h

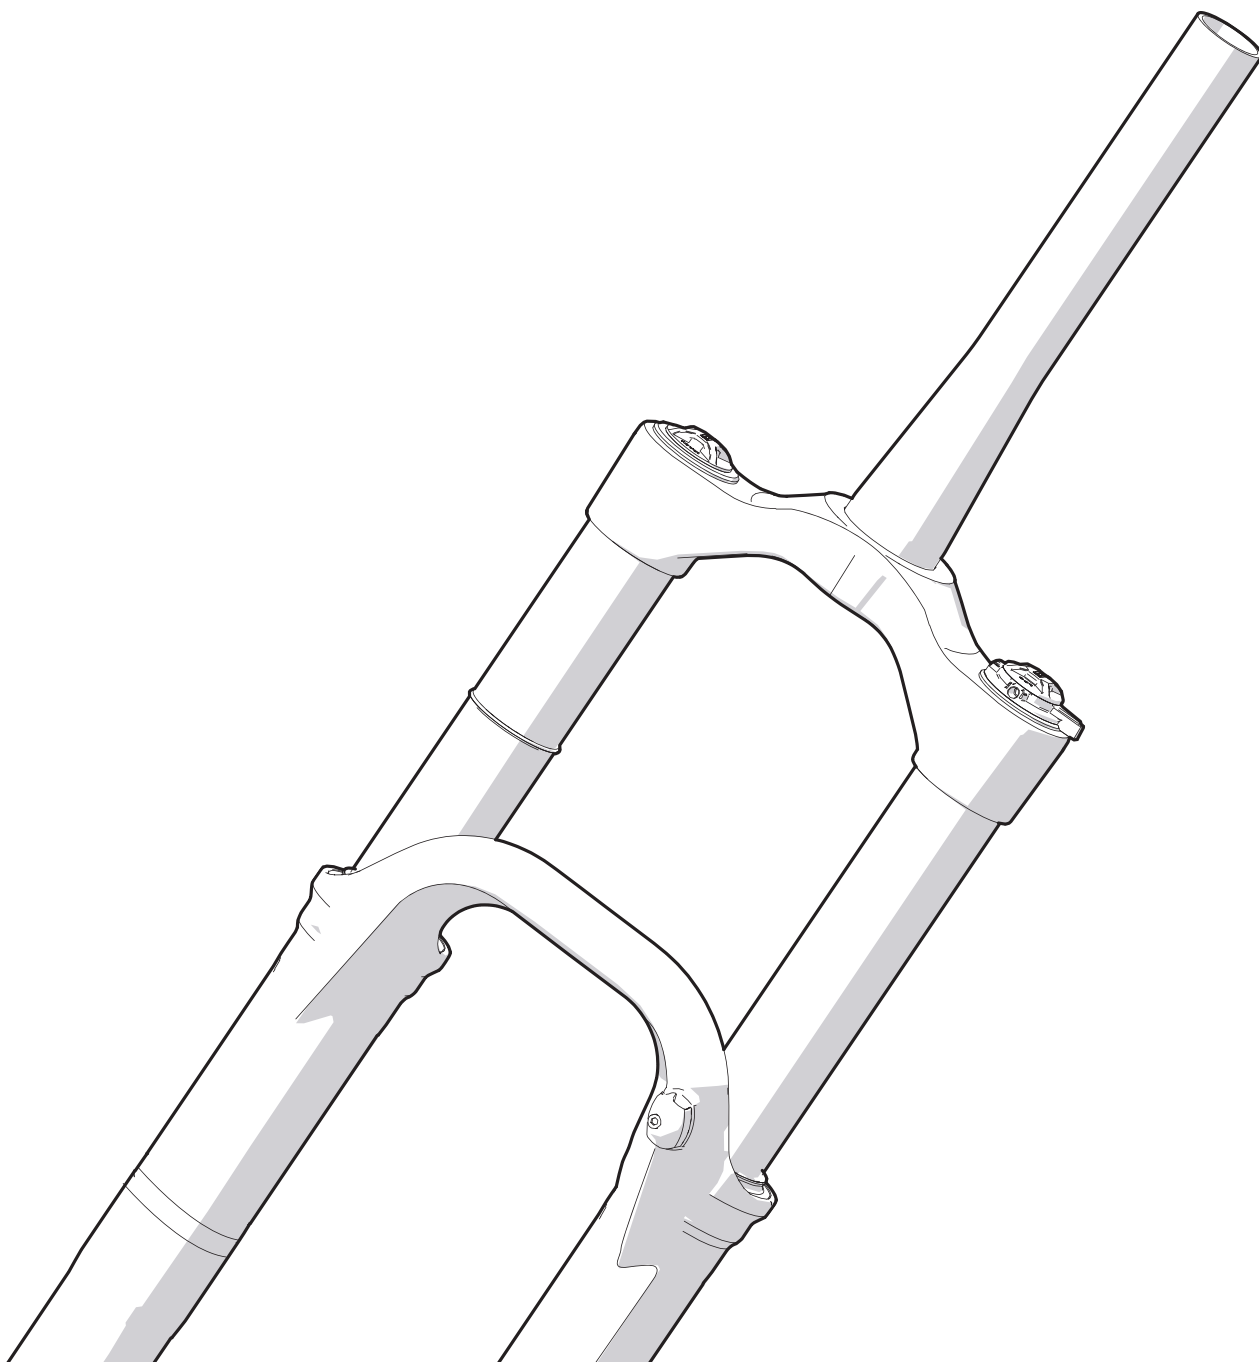

ÖHLINS

SAFETY PRECAUTIONS

General Warnings

Note!

The shock absorber/front fork/steering damper is an important part of the vehicle and will affect the stability.

Note!

Read and ensure you understand the information in this manual and other technical documents provided by Öhlins, before using the product.

Note!

Öhlins Group AB can not be held responsible for any damage to the shock absorber/front fork/steering damper, vehicle, other property or injury to persons, if the instructions for mounting, usage and maintenance are not followed exactly.

Warning!

After installing the Öhlins product, take a test ride at low speed to ensure your vehicle has maintained stability.

Warning!

If the suspension makes an abnormal noise, or the function is irregular, or if you notice any leakage from the product, stop the vehicle immediately and return the product to an Öhlins Service Centre.

Warning!

The product warranty shall only apply if the product has been operated and maintained in accordance with recommendations in this manual. If you have any questions regarding usage, service, inspection and/or maintenance please contact Öhlins.

Note!

When working with the Öhlins product, always read the Vehicle Service Manual.

Product Specific Warnings

Warning!

This product was developed and designed exclusively for a specific vehicle model and shall only be installed on the intended vehicle model in its original condition as delivered from the vehicle manufacturer.

Warning!

This product contains pressurized nitrogen gas (N₂). Do not open, service or modify this product without proper education (authorized Öhlins dealer/distributor) and proper tools.

SAFETY SYMBOLS

In this manual, mounting instructions and other technical documents, important information concerning safety is distinguished by the following symbols:



The Safety Alert Symbol means: Warning! Your safety is involved.

Warning!

The Warning Symbol means: Failure to follow warning instructions can result in severe or fatal injury to anyone working with, inspecting or using the shock absorber, or to bystanders.

Caution!

The Caution Symbol means: Special precautions must be taken to avoid damage to the shock absorber.

Note!

The Note Symbol indicates information that is important regarding procedures.

© Öhlins Group AB. All rights reserved.

Any reprinting or unauthorized use without the written permission of Öhlins Group AB is prohibited.

Oil, grease

Damper fluid	01309-01 - High performance suspension fluid 1L
Function grease	01338-22 - Renolit SI 410 M Silicone grease 225g

TABLE OF CONTENTS

Front Fork RXF38 m.1 50-Hour Service.....	3
Appendix A.....	8

RXF38 M.3/M.2/M.1 50-HOUR SERVICE

Front Fork RXF38 m.1 50-Hour Service

👁 Note!

Record the rebound adjuster setting and the pressure in the positive air chamber and ramp up chamber before service. We recommend using a bike stand to clamp the steering tube when working on the fork.

1. Thoroughly clean the outside of the fork from dirt or grit.

Only for RXF38 m.1!

2. Remove the golden bash caps by unscrewing them by hand.






3. Measure and record LSC, HSC and Rebound clicks.

4. Use a 14 mm wrench to hold the rebound adjuster knob steady. With a 2 mm hex wrench remove the screw and the knob.

5. Remove the nut on both sides by using a socket wrench with a 14 mm deep hex socket.

6. Slide the lower legs off the stanchions.

7. Drain the lower legs of all fluids.

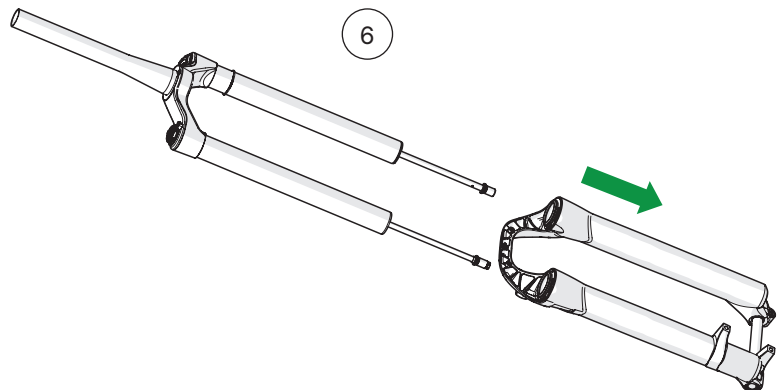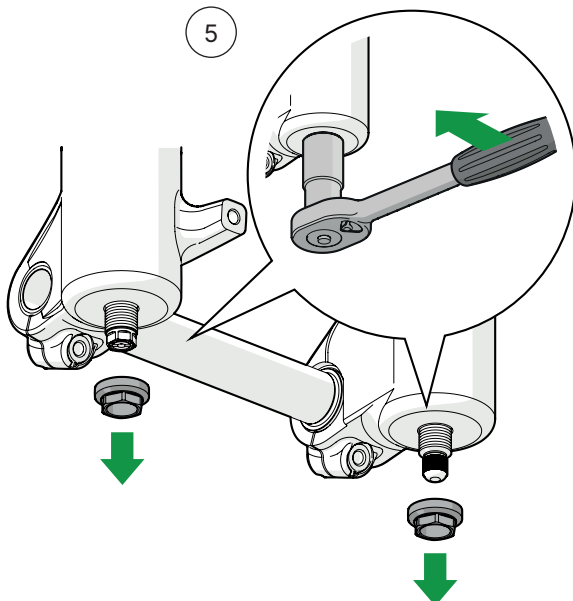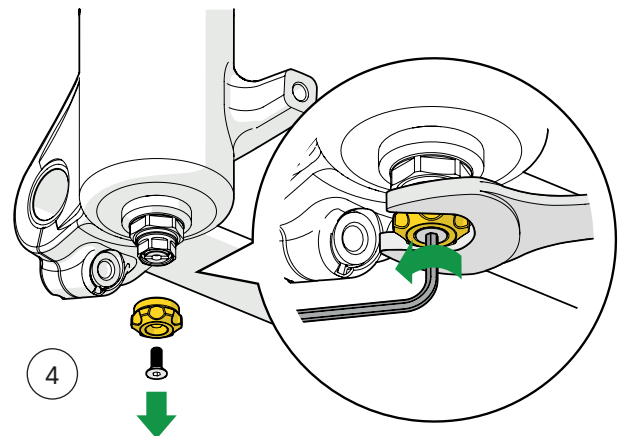
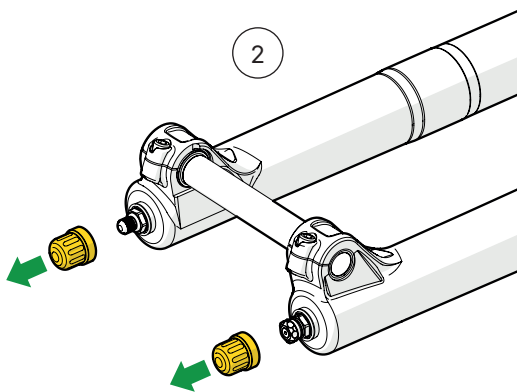
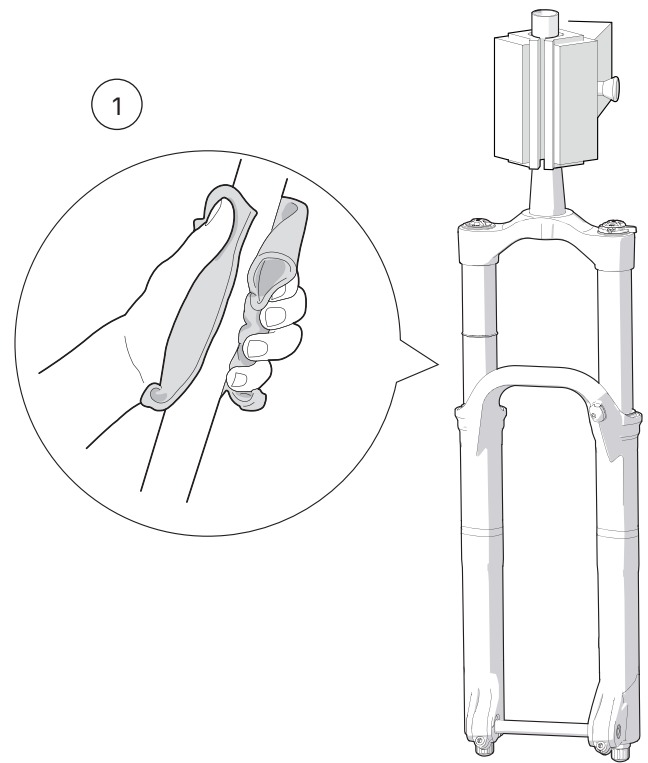


RXF38 M.3/M.2/M.1 50-HOUR SERVICE

8. Use tweezers to cautiously remove the foam rings in the lower legs.

9. Carefully clean the foam rings using disc brake cleaner and a paper cloth or rag to remove old suspension fluid and dirt. Inspect for damages and replace if necessary.

10. Soak the foam rings in fresh damper fluid.

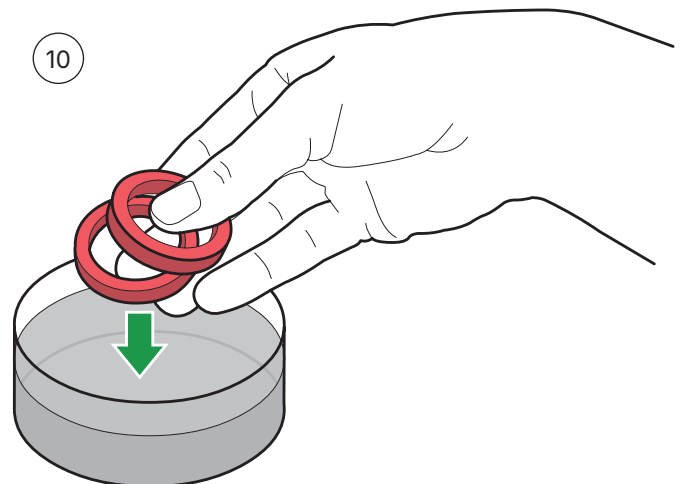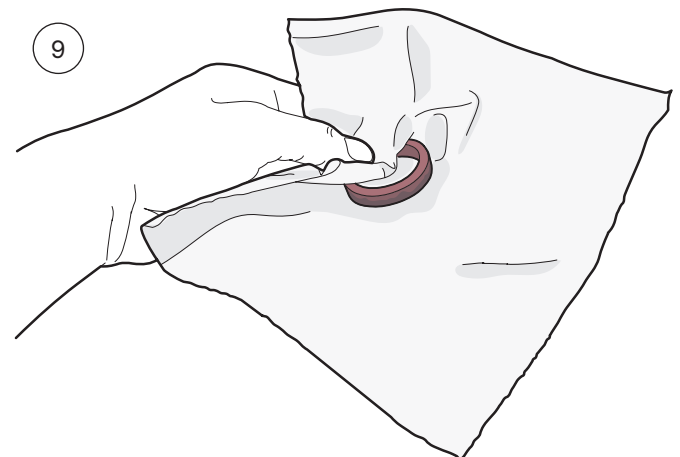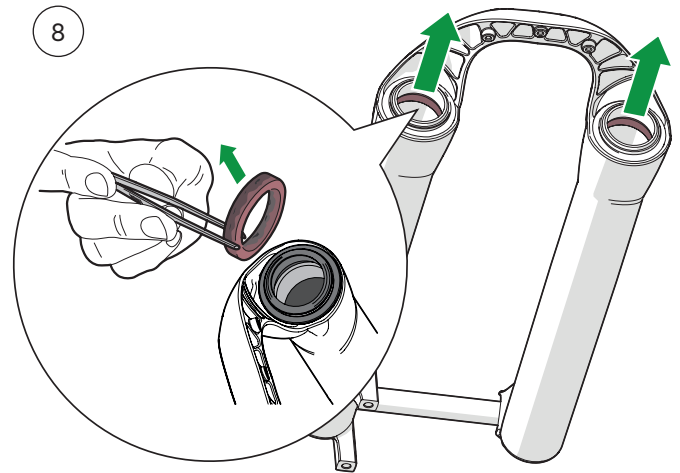

RXF38 M.3/M.2/M.1 50-HOUR SERVICE




11. Hold the lower legs upside down and clean the wiper seals and the upper bushings with a soft rag.

12. Use a rag wrapped around a long rod or similar to clean the insides of the lower legs.

👁 **Note!**

Be careful not to scratch the bushings.

13. Use tweezers to carefully re-insert the soaked foam rings into the lower legs. Check that they are mounted correctly and not twisted.

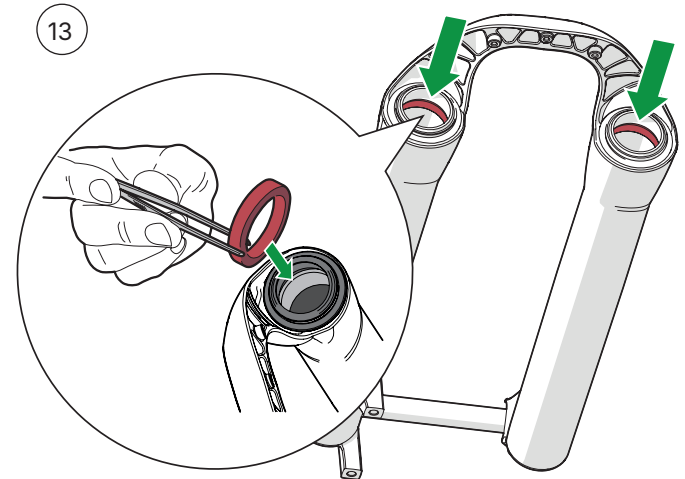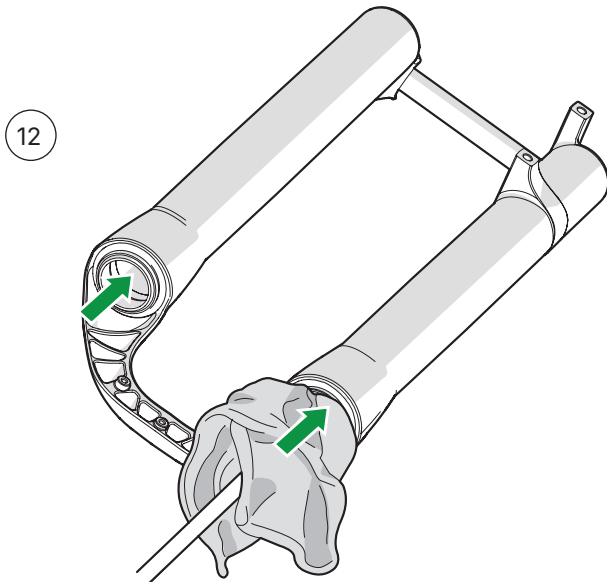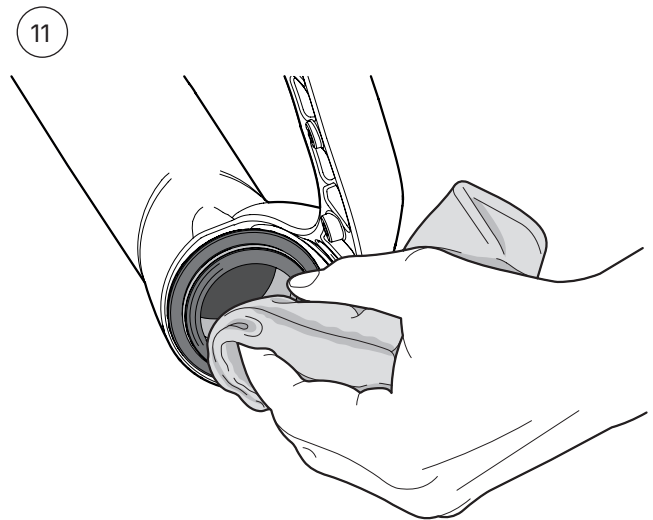





RXF38 M.3/M.2/M.1 50-HOUR SERVICE

14. Hold the lower legs upside down and use a soft rag inside the wiper seals to wipe of any oil residues from previous step.

15. Apply a thin layer of function grease to the inner surfaces of the wiper seals.

16. Clean the stanchion tubes with a paper cloth or soft rag.

17. Reinstall the stanchion tubes into the lower legs.

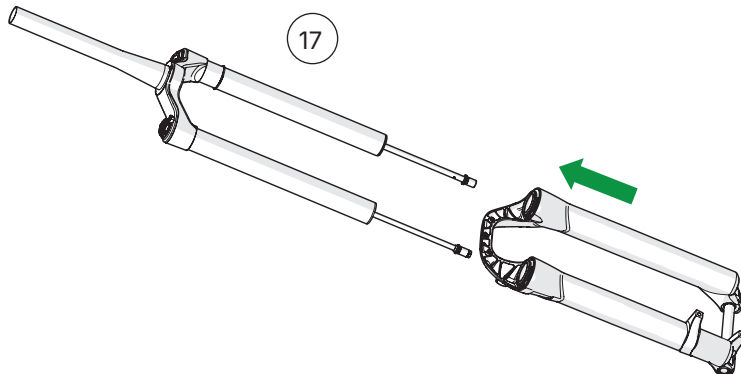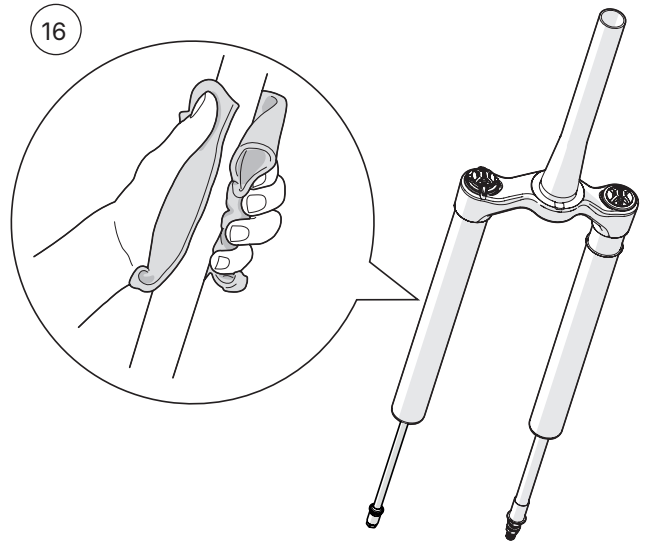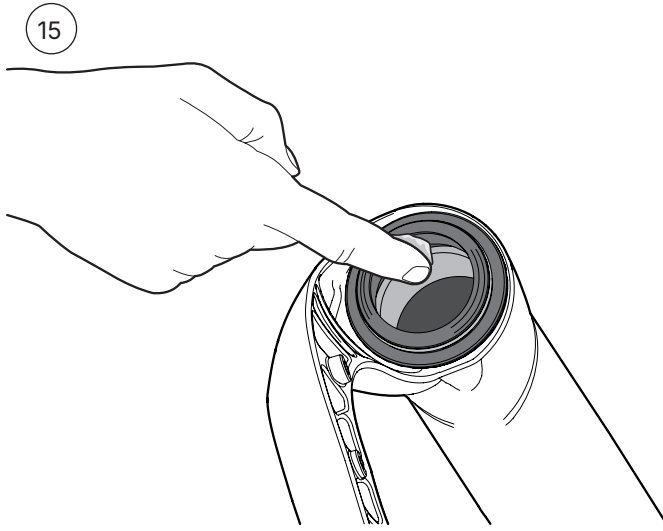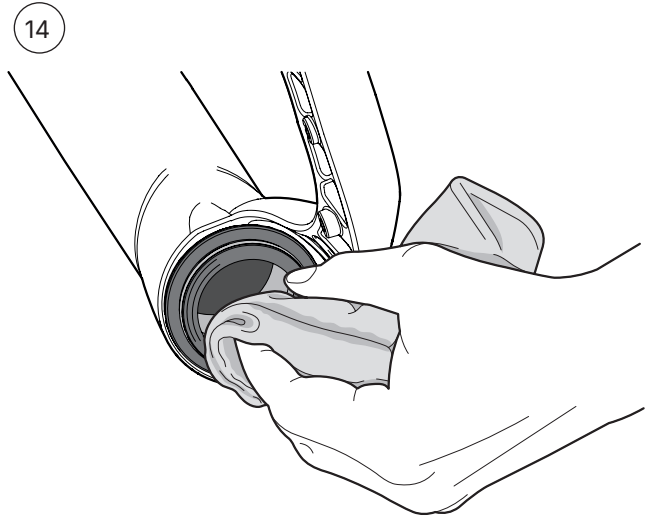

RXF38 M.3/M.2/M.1 50-HOUR SERVICE

18. Use fluids in spring and damper fork leg according to table below. It is important to not to overfill as it will affect fork performance.

Model	Fork part no.	Damper fork leg		Spring fork leg	
		Oil	Volume	Oil	Volume
RXF38 m.3/m.2	FGxxx 381x 25xx/22xx	Damper fluid	15 ml	Damper fluid	15 ml*
RXF38 m.1	FGxxx 381x 21xx	Damper fluid	10 ml	Damper fluid	10 ml

* For coil spring forks add 20 ml instead of 15 ml in the spring fork leg.
See appendix A to determine the part no. of the fork.

19. Reinstall the nuts. Use a torque wrench with a 14 mm hex socket and tighten to 10 Nm.

20. Reinstall the rebound adjuster knob and screw. Use a 14 mm wrench to hold the knob steady. With a 2 mm hex wrench tighten the screw and knob.

21. Adjust the rebound setting according to values recorded at step 3.

22. Adjust the LSC and HSC setting according to values recorded at step 3.

Only for RXF38 m.1!

23. Reinstall the golden bash caps. Tighten by hand.






24. Install the fork on the bike according to instructions in the Owner's manual.

⚠ Warning!

If the bottom crown is mounted too low the crown will make contact with the tire when bottoming. Always remove air spring pressure and compress the fork fully after mounting to ensure proper tire clearance. Please consult the Owner's manual for further details.

See Owner's Manual/Mounting Instructions for more information.



25. Go out and enjoy your ride!

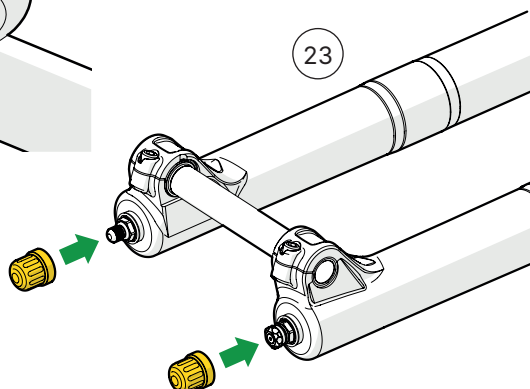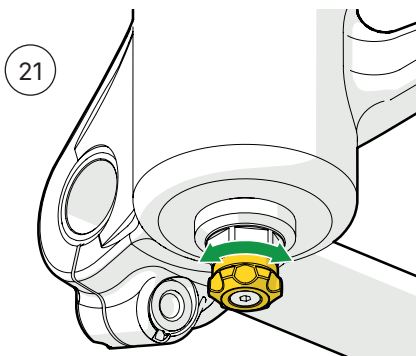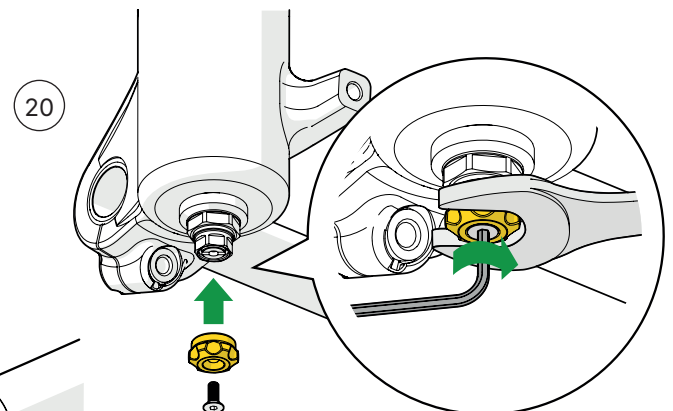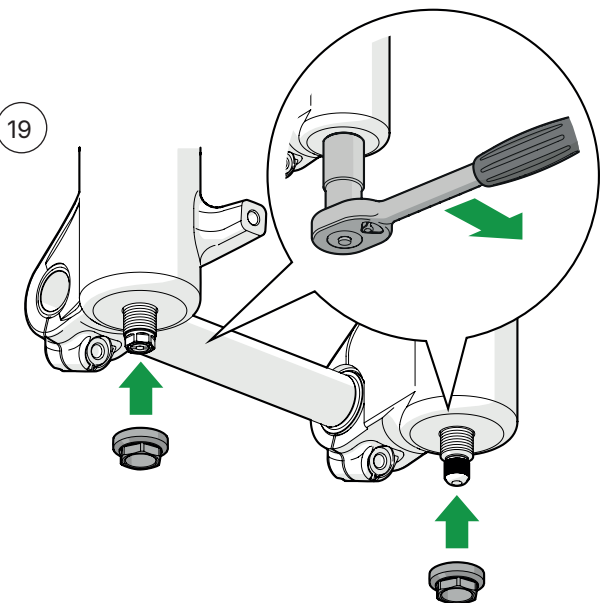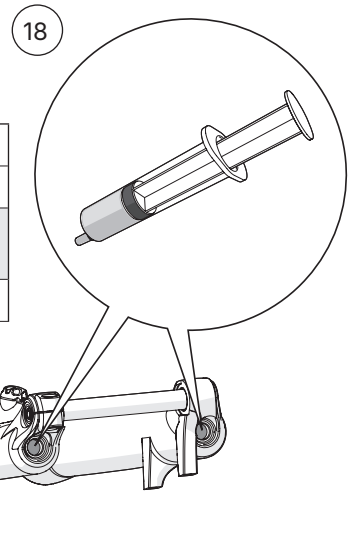

RXF38 M.3/M.2/M.1 50-HOUR SERVICE

Appendix A

Part no of the fork can be found at the bottom of the steering tube.

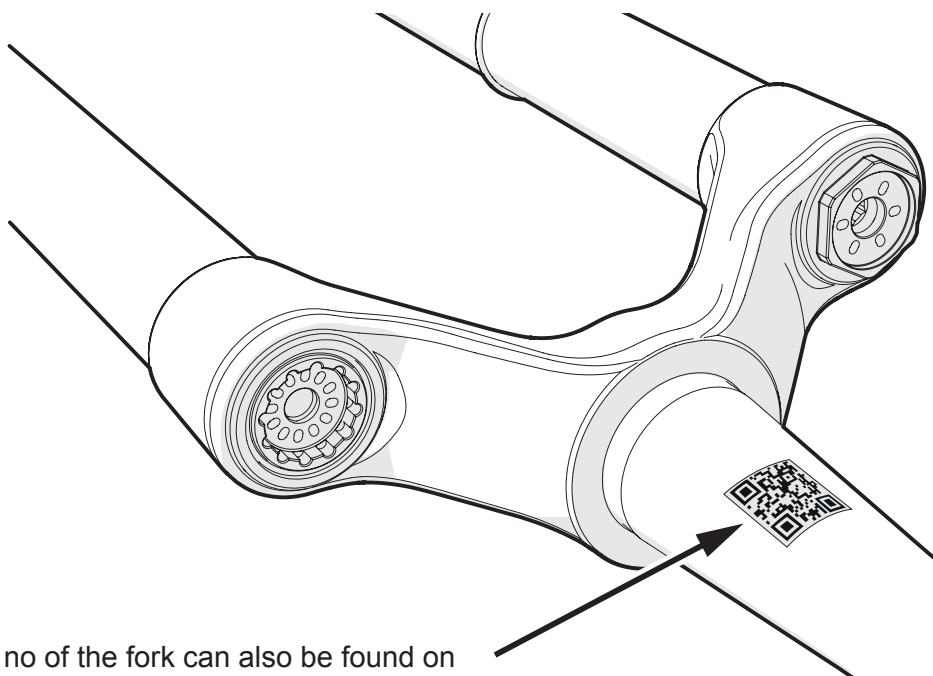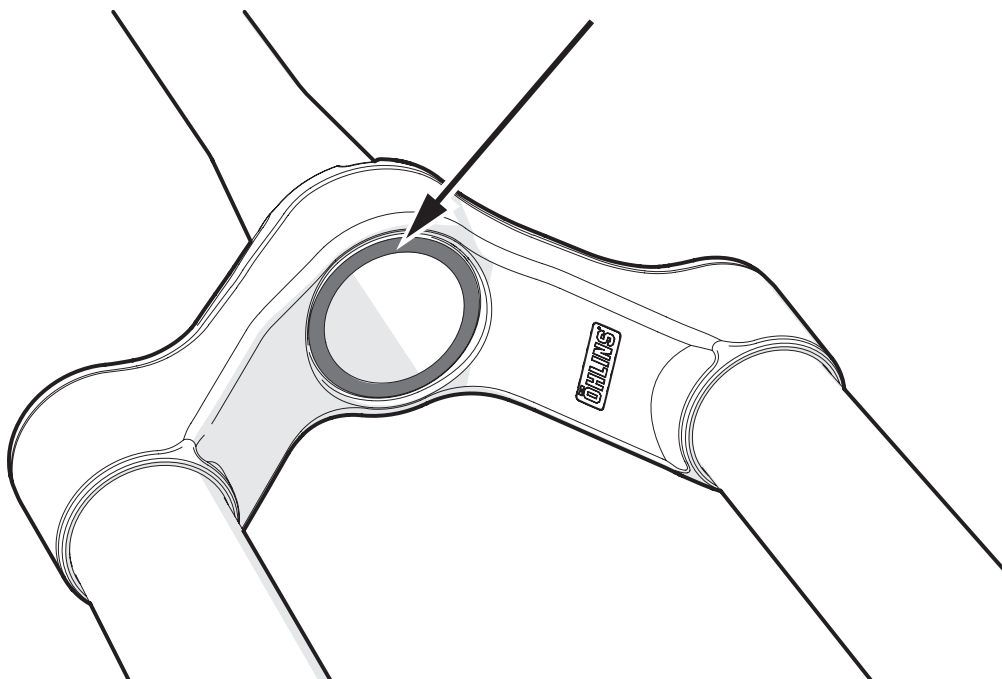

The part no of the fork can also be found on the steerer tube as a QR-code. Use a QR-code reader in a smartphone to receive the part no.

RXF38 M.3/M.2/M.1 50-HOUR SERVICE

Your Öhlins retailer:

Öhlins Group AB
Box 722
SE-194 27, Upplands Väsby
Sweden

Phone: +46 (0)8 590 025 00
Fax: +46 (0)8 590 025 80
www.ohlins.com



ÖHLINS

ÖHLINS.COM